

From: Mathieu Wacowich
Sent: Friday, July 28, 2006 9:04 AM
To: Eric Coffin
CC: Les Galbraith
Subject: RE: Basin Till Liner

Mr. Eric:

I had a discussion with Les about our previous conversation and if you are in fact talking about the Upstream U Zone material between Ch. 14+50 and Ch.15+75-ish then we suggest that this material be removed and underlined with till material to ensure that there is sufficient coverage of a basin liner in the area. If you recall, there was a seepage problem downstream of the embankment in this area, placing the till liner underneath the U zone will minimize this seeping effect.

Please advise MPMC to: 1) remove the U Zone material; 2) temporarily stockpile the material nearby; 3) place the till liner so that it joins up with the S Zone core material; and 4) replace the U Zone material while ensuring that compaction requirements are met.

This work will have to extend for as far as you are comfortable with, again ensuring that the area has proper basin liner coverage and keeping in mind that you will be limited by the extent of the beach and water level in the the area.

If you have any further questions, please call.

Cheers,

Matt

From: Eric Coffin
Sent: Friday, July 28, 2006 8:17 AM
To: Mathieu Wacowich
Subject: